


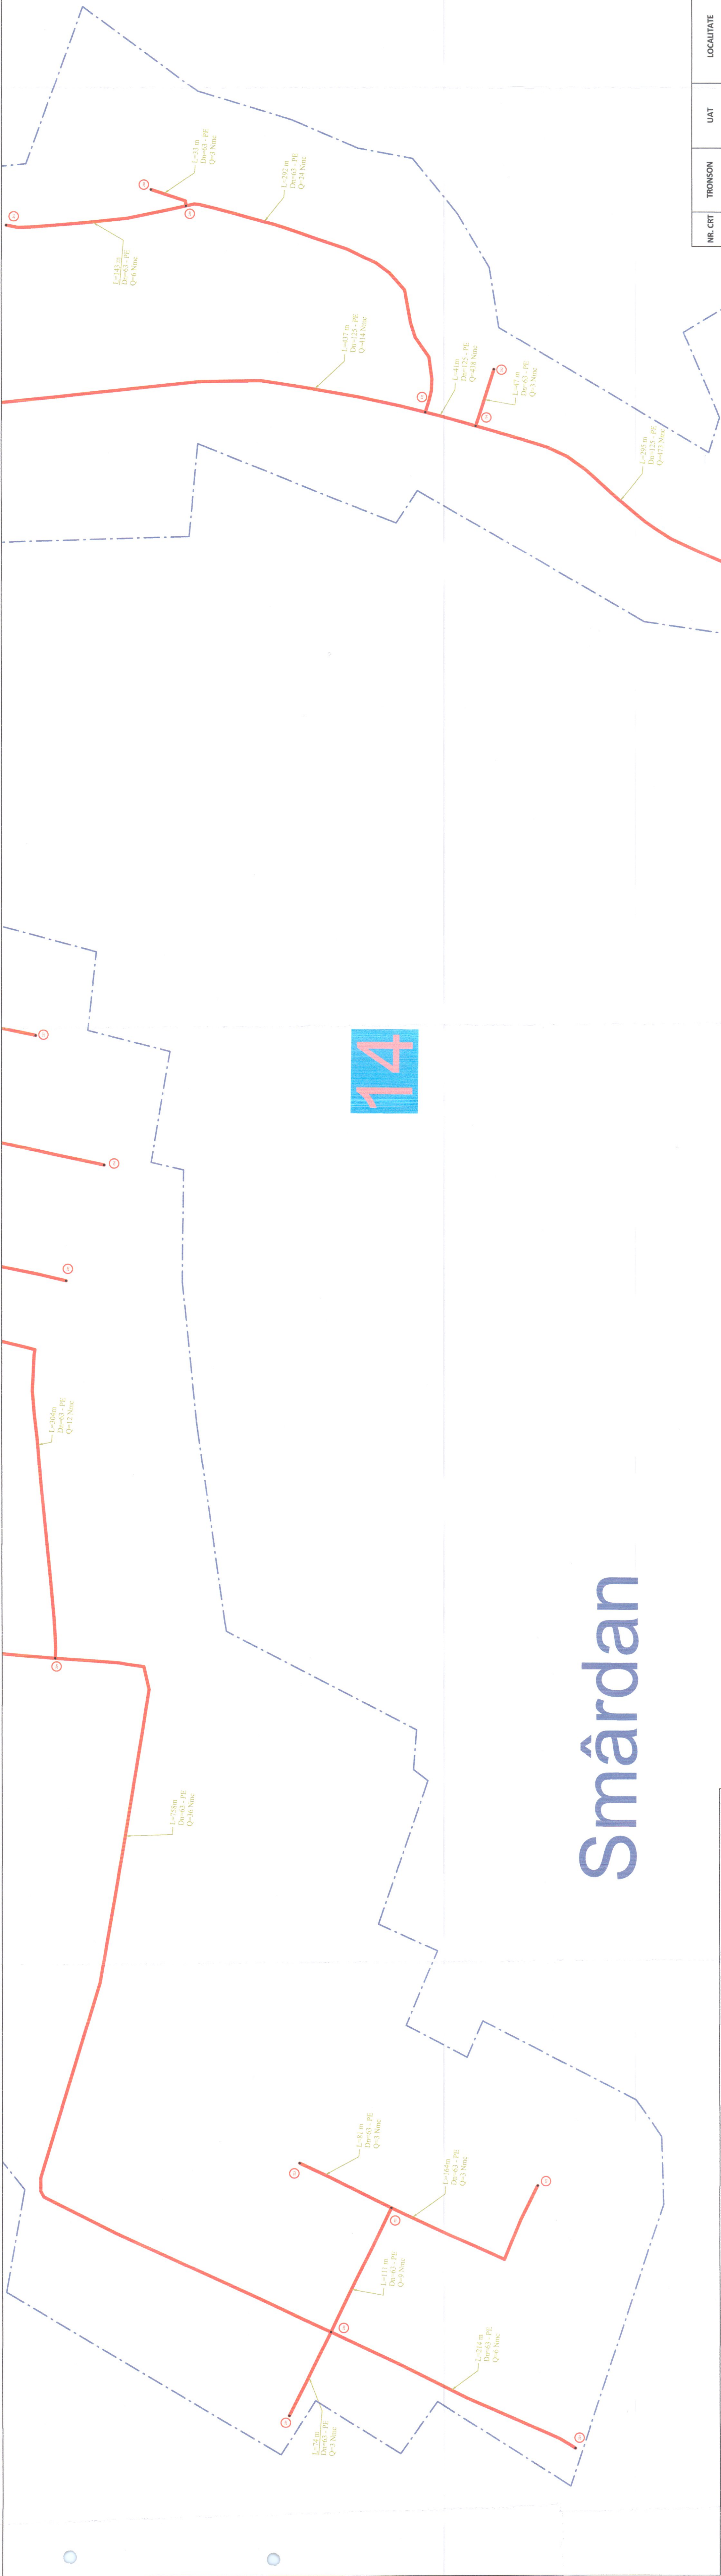

Smârdan

Nr. CRT	TRONSON		UAT	LOCALITATE	LUNGIME FIDCA [m]	MATERIAL	DIAMETRU [DN (mm/inch)]	DEBIT		VITEZA CALCUL [m/s]	PRESIUNE	
	NOD INTRARE ESERE	NOD IESIRE						CALCUL	INTRARE		INTRARE	IESIRE
862	125	126	COMANA	Smârdan	10	PE100 SDR11	63	162	1.68	2.27	2.27	2.27
863	212	213	Beciu	Smârdan	10	PE100 SDR11	63	162	1.68	2.27	2.27	2.27
864	213	214	Beciu	Smârdan	125	PE100 SDR11	63	138	1.68	2.26	2.26	2.26
867	214	215	Beciu	Smârdan	354	PE100 SDR11	63	108	1.46	2.24	2.23	2.23
868	215	216	Beciu	Smârdan	504	PE100 SDR11	63	76	1.08	2.22	2.21	2.21
869	216	217	Beciu	Smârdan	504	PE100 SDR11	63	76	1.08	2.22	2.21	2.21
870	217	218	Beciu	Smârdan	312	PE100 SDR11	63	69	0.86	2.21	2.19	2.19
871	218	219	Beciu	Smârdan	39	PE100 SDR11	63	31	0.08	2.19	2.17	2.17
872	219	220	Beciu	Smârdan	81	PE100 SDR11	63	3	0.12	2.15	2.14	2.14
873	220	221	Beciu	Smârdan	111	PE100 SDR11	63	3	0.12	2.15	2.14	2.14
874	221	222	Beciu	Smârdan	111	PE100 SDR11	63	3	0.12	2.15	2.14	2.14
875	222	223	Beciu	Smârdan	224	PE100 SDR11	63	6	0.26	2.17	2.15	2.15
876	223	224	Beciu	Smârdan	74	PE100 SDR11	63	3	0.06	2.17	2.15	2.15
877	224	225	Beciu	Smârdan	304	PE100 SDR11	63	12	0.46	2.18	2.17	2.17
878	225	226	Beciu	Smârdan	115	PE100 SDR11	63	5	0.08	2.21	2.20	2.20
879	226	227	Beciu	Smârdan	114	PE100 SDR11	63	6	0.46	2.22	2.21	2.21
880	227	228	Beciu	Smârdan	151	PE100 SDR11	63	9	0.26	2.22	2.21	2.21
881	228	229	Beciu	Smârdan	151	PE100 SDR11	63	9	0.26	2.22	2.21	2.21

Nr. CRT	TRONSON		UAT [COMUNA]	LOCALITATE	LUNGIME FIDCA [m]	MATERIAL	DIAMETRU [DN (mm/inch)]	DEBIT [m ³ /s]		VITEZA CALCUL [m/s]	PRESIUNE ESERE [bar]	
	NOD INTRARE	NOD IESIRE						INTRARE	IESIRE			
795	123	124	Beciu	Beciu	225	PE100 SDR11	125	897	1.12	2.66	2.63	2.63
796	124	125	Beciu	Beciu	108	PE100 SDR11	63	138	1.68	2.27	2.26	2.26
797	125	126	Beciu	Beciu	354	PE100 SDR11	63	108	1.46	2.24	2.23	2.23
798	126	127	Beciu	Beciu	504	PE100 SDR11	63	76	1.08	2.22	2.21	2.21
799	127	128	Beciu	Beciu	504	PE100 SDR11	63	76	1.08	2.22	2.21	2.21
800	128	129	Beciu	Beciu	312	PE100 SDR11	63	69	0.86	2.21	2.19	2.19
801	129	130	Beciu	Beciu	390	PE100 SDR11	125	69	0.86	2.20	2.18	2.18
802	130	131	Beciu	Beciu	390	PE100 SDR11	125	69	0.86	2.20	2.18	2.18
803	131	132	Beciu	Beciu	429	PE100 SDR11	125	51	0.64	2.24	2.23	2.23
804	132	133	Beciu	Beciu	442	PE100 SDR11	125	51	0.64	2.24	2.23	2.23
805	133	134	Beciu	Beciu	479	PE100 SDR11	125	40	0.38	2.40	2.37	2.37
806	134	135	Beciu	Beciu	479	PE100 SDR11	125	40	0.38	2.40	2.37	2.37
807	135	136	Beciu	Beciu	417	PE100 SDR11	125	438	4.46	2.37	2.35	2.35
808	136	137	Beciu	Beciu	437	PE100 SDR11	125	414	0.40	2.35	2.32	2.32
809	137	138	Beciu	Beciu	437	PE100 SDR11	125	414	0.40	2.35	2.32	2.32
810	138	139	Beciu	Beciu	467	PE100 SDR11	125	92	0.38	2.36	2.33	2.33
811	139	140	Beciu	Beciu	467	PE100 SDR11	125	92	0.38	2.36	2.33	2.33
812	140	141	Beciu	Beciu	487	PE100 SDR11	125	74	0.32	2.27	2.24	2.24
813	141	142	Beciu	Beciu	487	PE100 SDR11	125	74	0.32	2.27	2.24	2.24
814	142	143	Beciu	Beciu	398	PE100 SDR11	90	80	0.23	2.18	2.18	2.18
815	143	144	Beciu	Beciu	398	PE100 SDR11	90	80	0.23	2.18	2.18	2.18
816	144	145	Beciu	Beciu	224	PE100 SDR11	63	83	0.18	2.19	2.18	2.18
817	145	146	Beciu	Beciu	224	PE100 SDR11	63	83	0.18	2.19	2.18	2.18
818	146	147	Beciu	Beciu	178	PE100 SDR11	63	30	0.18	2.27	2.26	2.26
819	147	148	Beciu	Beciu	178	PE100 SDR11	63	30	0.18	2.27	2.26	2.26
820	148	149	Beciu	Beciu	430	PE100 SDR11	63	12	0.41	2.23	2.22	2.22
821	149	150	Beciu	Beciu	430	PE100 SDR11	63	12	0.41	2.23	2.22	2.22
822	150	151	Beciu	Beciu	467	PE100 SDR11	63	71	0.62	2.36	2.35	2.35
823	151	152	Beciu	Beciu	467	PE100 SDR11	63	71	0.62	2.36	2.35	2.35
824	152	153	Beciu	Beciu	292	PE100 SDR11	63	24	0.62	2.35	2.28	2.28
825	153	154	Beciu	Beciu	292	PE100 SDR11	63	24	0.62	2.35	2.28	2.28
826	154	155	Beciu	Beciu	943	PE100 SDR11	63	5	0.48	2.25	2.24	2.24
827	155	156	Beciu	Beciu	943	PE100 SDR11	63	5	0.48	2.25	2.24	2.24
828	156	157	Beciu	Beciu	943	PE100 SDR11	63	5	0.48	2.25	2.24	2.24
829	157	158	Beciu	Beciu	91	PE100 SDR11	63	3	0.06	2.40	2.39	2.39
830	158	159	Beciu	Beciu	91	PE100 SDR11	63	3	0.06	2.40	2.39	2.39
831	159	160	Beciu	Beciu	30	PE100 SDR11	63	3	0.06	2.43	2.42	2.42
832	160	161	Beciu	Beciu	30	PE100 SDR11	63	3	0.06	2.43	2.42	2.42
833	161	162	Beciu	Beciu	131	PE100 SDR11	63	135	4.32	2.45	2.40	2.40
834	162	163	Beciu	Beciu	131	PE100 SDR11	63	135	4.32	2.45	2.40	2.40
835	163	164	Beciu	Beciu	520	PE100 SDR11	63	179	5.20	2.37	2.34	2.34
836	164	165	Beciu	Beciu	520	PE100 SDR11	63	179	5.20	2.37	2.34	2.34
837	165	166	Beciu	Beciu	260	PE100 SDR11	63	111	4.30	2.34	2.31	2.31
838	166	167	Beciu	Beciu	260	PE100 SDR11	63	111	4.30	2.34	2.31	2.31
839	167	168	Beciu	Beciu	105	PE100 SDR11	63	36	3.37	2.31	2.28	2.28
840	168	169	Beciu	Beciu	105	PE100 SDR11	63	36	3.37	2.31	2.28	2.28
841	169	170	Beciu	Beciu	9	PE100 SDR11	63	51	3.66	2.25	2.22	2.22
842	170	171	Beciu	Beciu	9	PE100 SDR11	63	51	3.66	2.25	2.22	2.22
843	171	172	Beciu	Beciu	26	PE100 SDR11	63	33	0.62	2.25	2.22	2.22
844	172	173	Beciu	Beciu	26	PE100 SDR11	63	33	0.62	2.25	2.22	2.22
845	173	174	Beciu	Beciu	75	PE100 SDR11	63	12	0.41	2.22	2.19	2.19
846	174	175	Beciu	Beciu	75	PE100 SDR11	63	12	0.41	2.22	2.19	2.19
847	175	176	Beciu	Beciu	111	PE100 SDR11	63	6	0.60	2.19	2.18	2.18
848	176	177	Beciu	Beciu	111	PE100 SDR11	63	6	0.60	2.19	2.18	2.18
849	177	178	Beciu	Beciu	207	PE100 SDR11	63	15	0.62	2.22	2.21	2.21
850	178	179	Beciu	Beciu	207	PE100 SDR11	63	15	0.62	2.22	2.21	2.21
851	179	180	Beciu	Beciu	429	PE100 SDR11	63	18	0.62	2.25	2.23	2.23
852	180	181	Beciu	Beciu	429	PE100 SDR11	63	18	0.62	2.25	2.23	2.23
853	181	182	Beciu	Beciu	349	PE100 SDR11	63	15	0.62	2.23	2.21	2.21
854	182	183	Beciu	Beciu	349	PE100 SDR11	63	15	0.62	2.23	2.21	2.21
855	183	184	Beciu	Beciu	149	PE100 SDR11	63	9	0.38	2.23	2.21	2.21
856	184	185	Beciu	Beciu	149	PE100 SDR11	63	9	0.38	2.23	2.21	2.21
857	185	186	Beciu	Beciu	38	PE100 SDR11	63	6	0.12	2.28	2.27	2.27
858	186	187	Beciu	Beciu	38	PE100 SDR11	63	6	0.12	2.28	2.27	2.27
859	187	188	Beciu	Beciu	207	PE100 SDR11	63	18	0.62	2.34	2.33	2.33
860	188	189	Beciu	Beciu	207	PE100 SDR11	63	18	0.62	2.34	2.33	2.33
861	189	190	Beciu	Beciu	117	PE100 SDR11	63	6	0.12	2.33	2.32	2.32
862	190	191	Beciu	Beciu	42	PE100 SDR11	63	6	0.12	2.33	2.32	2.32
863	191	192	Beciu	Beciu	42	PE100 SDR11	63	6	0.12	2.33	2.32	2.32
864	192	193	Beciu	Beciu	206	PE100 SDR11	63	3	0.06	2.40	2.39	2.39
865	193	194	Beciu	Beciu	206	PE100 SDR11	63	3	0.06	2.40	2.39	2.39
866	194	195	Beciu	Beciu	9	PE100 SDR11	63	3	0.06	2.48	2.47	2.47
867	195	196	Beciu	Beciu	9	PE100 SDR11	63	3	0.06	2.48	2.47	2.47
868	196	197	Beciu	Beciu	38	PE100 SDR11	63	9	0.28	2.50	2.49	2.49
869	197	198	Beciu	Beciu	38	PE100 SDR11	63	9	0.28	2.50	2.49	2.49
870	198	199	Beciu	Beciu	27	PE100 SDR11	63	3	0.11	2.49	2.48	2.48
871	199	200	Beciu	Beciu	27	PE100 SDR11	63	3	0.11	2.49	2.48	2.48
872	200	201	Beciu	Beciu	149	PE100 SDR11	63	18	0.62	2.33	2.32	2.32
873	201	202	Beciu	Beciu	149	PE100 SDR11	63	18	0.62	2.33	2.32	2.32
874	202	203	Beciu	Beciu	206	PE100 SDR11	63	2	0.06	2.52	2.50	2.50
875	203	204	Beciu	Beciu	206	PE100 SDR11	63	2	0.06	2.52	2.50	2.50
876	204	205	Beciu	Beciu	60	PE100 SDR11	63	3	0.06	2.56	2.53	2.53
877	205	206	Beciu	Beciu	60	PE100 SDR11	63	3	0.06	2.56	2.53	2.53
878	206	207	Beciu	Beciu	89	PE100 SDR11	63	3	0.06	2.58	2.57	2.57
879	207	208	Beciu	Beciu	89	PE100 SDR11	63	3	0.06	2.58	2.57	2.57
880	208	209	Beciu	Beciu	464	PE100 SDR11	63	37	0.62	2.61	2.58	2.58
881	209	210	Beciu	Beciu	464	PE100 SDR11	63	37	0.62	2.61	2.58	2.58
882	210	211	Beciu	Beciu	41	PE100 SDR11	63	3	0.06	2.62	2.61	2.61
883	211	212	Beciu	Beciu	41	PE100 SDR11	63	3	0.06	2.62	2.61	2.61
884	212	213	Beciu	Beciu	466	PE100 SDR11	63	39	0.62	2.62	2.59	2.59
885	213	214	Beciu	Beciu	466	PE100 SDR11	63	39	0.62	2.62	2.59	2.59